

Mounting Instruction

Plug 150 + RG11

FuG Elektronik GmbH
Am Eschengrund 11
83135 Schechen
Germany

info@fug-elektronik.de
www.fug-elektronik.de

Phone: +49 8039 40077 0
Fax: +49 8039 40077 99

1 Prepare the cable

ATTENTION!
Don't cut a notch into the central isolation!

S130:	87 mm
S150:	137 mm
HVS 65:	219 mm
HVS 100:	374 mm

2 Solder the central conductor

solder

c) Smooth and thin out for about 50% the braided shield and push

b) Pull on the clamping sleeve

a) Pull on the strain relief

3 Assemble all parts together

pull on

slide in

Protect central conductor

Bend back the shield wires completely and put them smoothly onto the body of the clamping sleeve. Don't cross wires. Cut off approx. 2mm behind O-ring.

4 Screw together the front part of the plug with the strain relief

Grease the thread with silicon

fasten the sleeve nut

fasten the strain relief

This mounting instruction is also valid logically for connectors of the same construction e.g. S130, HVS 65, HVS 100 or HVS 150. The difference is only in the length of the plug

Informations about the necessary space on the rear side of the unit

Connector S150 + cable RG11

